

Date: Thursday, 7/19/2007 2:19:04 PM
 User: Kim Johnston

Process Sheet

32

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FLOAT SKID RH 206L1,L3,L4&407
Job Number	: 33625		
Estimate Number	: 10328		
P.O. Number	: N/A	Part Number	: D206642512
This Issue	: 7/19/2007 S.O. No. : N/A	Drawing Number	: N/A
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: NA Type : LANDING GEAR	Drawing Revision	: K
Previous Run	: 33624	Material	: N/A
Written By	: <u>JA 07.07.19</u>	Due Date	: 8/10/2007
Checked & Approved By	: <u>JA 07.07.19</u>	Qty:	1 Um: Each
Comment	Est Rev: B 05.09.23 Revised per D206-642 Rev. J KJ/JLM Est Rev: C 07-02-23 As per IIN D206-642 Rev K JLM est rev D 07.06.06 added K642-512 EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels per PPP D206-642-512 CHG003

KS 07.07.30 ①

2.0	33625A	FLOAT SKIDTUBE ASSEMBLY
-----	--------	-------------------------



Comment: Sub-Component FLOAT SKIDTUBE ASSEMBLY

D206-642-541 B 33625A

7/8/25 SL

3.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

4.0	K642 512	saddle kit 642-511
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

saddle kit 642-512

batch: 33665

7/8/25

5.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
-----	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

C207/08/25 ①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 07/09/07
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:04 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKID RH 206L1,L3,L4&407

Job Number: 33625

Part Number: D206642512

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-642-512

Location: 33625A

7/4/25 SJ

7.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

107K8127 (1)

Job Completion



U 07-08-27

B33625A

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

512

32

Date: Thursday, 7/19/2007 2:19:39 PM
User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: FLOAT SKIDTUBE ASSEMBLY
Job Number	: 33625A		
Estimate Number	: 10309		
P.O. Number	: <i>N/A</i>	Part Number	: D206642541
This Issue	: 7/19/2007	S.O. No.	: <i>N/A</i>
Prsht Rev.	: NC	Drawing Number	: D3274 REV D
First Issue	: <i>N/A</i>	Project Number	: N/A
Previous Run	: 33624A	Drawing Revision	: D
	Type : LANDING GEAR	Material	: <i>N/A</i>
Written By	: <i>[Signature]</i>	Due Date	: 8/10/2007
Checked & Approved By	: <i>[Signature]</i> 07.07.19	Qty:	1 Um: Each
Comment	Est Rev: B 05.09.23 Revised per D206-642 Rev. J KJ/JLM Est Rev: C 07-02-23 Added SS Wearplates & Gaskets JLM		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



Comment: DOCUMENT CONTROL

Photocopy bluefile & type labels per PPP D206-642-541 CHG003

N/A

2.0	D26001190	Extrusion Round 3" 206
-----	-----------	------------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2600-1-190 3" OD Tube

B24841

DP 7-7-23

3.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
-----	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Cut D2600-1 to 190.00" in length as per Dwg D3274 and Deburr ends

2-Drill #40 Aft cap pilot hole using DT8025

3-Cleco DT8025 in position and install pilot hole drill Jig DT8742A,B,C,D. Drill 3/16" pilot holes as per Dwg D3274

4-Remove inner indexing ridge on aft end of skidtube as per Dwg D3274

5-Open aft end cap holes to Ø0.208" as per Dwg D3274. Deburr aft end.

DP

7-7-23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B:			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

4.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Acid Etch and Alodine tube as per QSI 005 4.1

R 7-7-23

5.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

En 070723 (41)

6.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

En 070723 (41)

7.0

D3282041

I-Beam



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3282-041 Float Web

B 333 73

R 7-7-24

8.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Open Ø0.313" crossbolt spacer holes using DT8743 as per Dwg D3274

2-Open Ø0.375" crossbolt spacer holes using DT8744 as per Dwg D3274

3-Deburr crossbolt spacer holes as per Dwg D3274 and blow out chips from inside the tube

4-Bond web in place as per Dwg D3274 & QSI 015.

A/R Sikaflex-291

M 104732

Sikaflex expire date:

8-1-1

Start:

9:25 7-7-24 Time: 9:50

Finish:

7:30 Time: 7:30

(Adhere for 12 hours)

R 7-7-24

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Pin goes through and allows with the tubes

En 070725 (41)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Bend tube using program D3274 as per Dwg D3274. Install drop pins in cross bolt spacer holes to maintain web position.

2-Cut Fwd end of tube to length as per Dwg D3274

3-Remove inner indexing ridge on Fwd end of skidtube as per Dwg D3274

4- DRILL PILOT HOLES FOR WEARPLATES USING D3274-1T2
OPEN HOLES TO .297"

5-DRILL TOE PIN HOLE .640" DIA AS PER DWG USING DT8935 FWD END OF TUBE
DEBURR INSIDE OF HOLE AS NECESSARY (DO NOT ENLARGE HOLES)
REMOVE ANY FOREIGN OBJECTS INSIDE OF TUBES

6- Countersink crossbolt spacer holes as per Dwg D3274

EL/12
7-7-25

ND
7-8-4

11.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

BE 7-8-7

12.0

D32851

Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3285-1

Fwd Cap

B33374

BE 7-8-7

13.0

D2649

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total : 12.0000 Each(s)

Pick:

Qty Part Number Description Batch

12 D2649

Crossbolt spacer

B31926

BE 7-8-7

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

14.0

D32751

Crossbolt Spacer



Comment: Qty.: 12.0000 Each(s)/Unit Total: 12.0000 Each(s)

Pick:

Qty Part Number

Description Batch

12 D3275-1

Crossbolt spacer

B-33429

BE 07-8-7

15.0

LANDING GEAR 1

LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Weld Fwd Cap as per Dwg D3274 and QSI 004. Use aluminum rod.

A/R Aluminum Rod m104907/m104221

BE 7-8-7

2-Insert D2649 & D3275-1 crossbolt spacers. Weld as per QSI 004 and Dwg D3274. Remember to back drill each hole before welding the other side. Use aluminum rod

A/R Aluminum Rod m104221

BE 7-8-7

3-Grind welds flush to Fwd cap on top surface only.

BE 7-8-7

4-Grind cross bolt welds flush as per Dwg D3274. Masking Tape access to inside of the skidtube

for 07-08-08 (1)

5-Counterbore 5/16" x 0.750" deep as per Dwg D3274. Use DT8743 visual aid Jig and deburr.

for 07-08-08 (1)

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

EP 07/08/09 (2)

17.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

for 07/18/08 (2)

18.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

BR/M/07-08-15

19.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

FL 07/08/21 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:39 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

20.0

D3415041

Nut Plate



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch
1 D3415-041 Nut Plate 1333434

HS

21.0

CCR264SS33

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 CCR264SS3-3 Rivet M103525

HS

22.0

CR3212403

Cherry Rivet



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number Description Batch
2 CR3212-4-03 Rivet M15918 X?

HS

23.0

ALS71032130

Insert



Comment: Qty.: 78.0000 Each(s)/Unit Total : 78.0000 Each(s)

Insert

Batch: M1024751 X?

HS

24.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

✓ 1-Install Nut Plate as per Dwg D3274. Apply LPS-3 to Nut Plate and rivets.
A/RN/ALPS-3 M102161

2-Install inserts as per Dwg D3274. Use a drop of Sikaflex inside insert holes a
A/R Sikaflex-291 M104989
Sikaflex expire date: 08-01

HS 07-08-21

01

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:39 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

25.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

Inspect Nut Plate & Inserts

EP 07/08/21

26.0

AN3C4A

BOLT



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

BOLT

Batch: M105143

EH

27.0

D353515

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B32737

EH

28.0

D353523

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B32411

EH

29.0

D353535

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B33371

EH

30.0

D353539

WEARSHOE



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARSHOE

Batch: B32429

EH X?

31.0

D353615

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B32746

EP 07-08-21

D

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:40 PM

User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

D353623

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B 32743

MH

33.0

D353635

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B 32788

HA

34.0

D353639

GASKET



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

GASKET

Batch: B 32905

MH

35.0

D35371

WEARPAD



Comment: Qty.: 9.0000 Each(s)/Unit Total : 9.0000 Each(s)

WEARPAD

Batch: B 33660

ess

36.0

D35373

WEARPAD



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

WEARPAD

Batch: B 33285

MH

37.0

AN960C10L

washer



Comment: Qty.: 80.0000 Each(s)/Unit Total : 80.0000 Each(s)

Pick:

Qty Part Number

Description Batch

80 AN960C10L

Washer M 105143

MH

38.0

NAS1515H3L

WASHER



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part Number

Description Batch

2 NAS1515H3L

Washer M 104603

HA

07-06-21

①

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:40 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

39.0

D34131

Ring



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D3413-1

Ring

B33433

251

40.0

AN4C5A

BOLT



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN4C5A

Bolt

M18918

251

41.0

AN960C416

washer



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 AN960C416

Washer

M100993

251

42.0

D2646

Aft Cap



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Pick:

Qty Part Number Description Batch

1 D2646

Aft Cap

B31335

251

43.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

2-Install wearpads & gaskets as per Dwg D3274.

3-Install ring as per Dwg D3274

A/R Sikaflex-291

M104989

Sikaflex expire date:

08-01

4-Inspect for foreign objects as per QSI 024

5-Spray inside of tube on both sides of web with LPS-3

A/R

LPS-3

Batch: M104161

6-Install Aft Cap and seal with Sikaflex. Clean excess adhesive.

251 07 08-21

1

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: D Date: 07/08/27
 QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 7/19/2007 2:19:40 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: FLOAT SKIDTUBE ASSEMBLY

Job Number: 33625A

Part Number: D206642541

Job Number:



Seq. #:

Machine Or Operation:

Description :

A/R Sikaflex-291 M104989
Sikaflex expire date: 08-01

W 04-08-2007

44.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

En 2/08/03 (41)

45.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock
Location: C

7/8/25 Sep

46.0

QC21

FINAL INSPECTION/W/O RELEASE



(1)

Comment: FINAL INSPECTION/W/O RELEASE

Done 27

Job Completion



W 07-08-27

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART

DESIGN CP	DRAWN BY PH	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D3274	REV. D SHEET 1 OF 4
DATE 06.12.19		TITLE SKIDTUBE ASSEMBLY	SCALE NTS
A	04.03.15	NEW ISSUE	
B	04.08.09	MOVE SADDLE HOLE: 42.14 WAS 42.76	
C	05.03.16	ADD -043; NEW INSERTS	
D	06.12.19	NEW INSERTS, SS WEARSHOE + GASKET	

RELEASED07.02.12 **[Signature]**

Qty -041	Qty -043	Part Number	Description
X		D3274-041	SKIDTUBE ASSEMBLY
	X	D3274-043	SKIDTUBE ASSEMBLY
1	1	D2600-1-240	EXTRUSION
1	1	D2646	AFT CAP
12	12	D2649	CROSS BOLT SPACER
12	37	D3275-1	CROSS BOLT SPACER
1	1	D3282-041	FLOAT WEB
1	1	D3285-1	CAP
1	1	D3413-1	RING
1	1	D3415-041	NUT PLATE
1	1	D3535-15	WEARSHOE
1	1	D3535-23	WEARSHOE
1	1	D3535-35	WEARSHOE
1	1	D3535-39	WEARSHOE
1	1	D3536-15	GASKET
1	1	D3536-23	GASKET
1	1	D3536-35	GASKET
1	1	D3536-39	GASKET
9	9	D3537-1	WEARPAD
1	1	D3537-3	WEARPAD
78	78	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, AELS-1032-130)
80	80	AN3C4A	BOLT
1	1	AN4C5A	BOLT
1	1	AN960C416	WASHER
80	80	AN960C10L	WASHER
2	2	CCR264SS3-3	RIVET
2	2	CR3212-4-03	RIVET
2	2	NAS1515H3L	WASHER

GENERAL NOTES:


1. TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
2. DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 7 INCHES^{RN} TO ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
3. ALL HOLES DRILLED ON CENTERLINES.
4. BOND D3282-041 FLOAT WEB INTO D3274-1/-3 OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241/291.
ADHESIVE PER DART QSI 015. ENSURE HOLES LINE-UP.
5. WELDING TO BE DONE PER DART QSI 004.
6. FINISH: - ACID ETCH, ALODINE ASSEMBLY PER DART QSI 005 4.1
- POWDER COAT WHITE (REF. 4.3.5.1) PER DART QSI 005 4.3
7. DRILL Ø0.297 HOLES FOR ALS7-1032-130 INSERTS USING DT3274-1T2 BEFORE FINISH. INSTALL ALS7-1032-130 INSERTS AFTER FINISH. SEAL WEARSHOE BOLTS WITH SIKAFLEX -241/-291.
8. SPRAY INSIDE OF TUBE WITH A COAT OF LPS LABORATORIES "LPS-3" AFTER FINISH AND INSTALLATION OF INSERTS. COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON" AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.

Copyright © 2004 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

SHOP COPY


ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. **33625A**

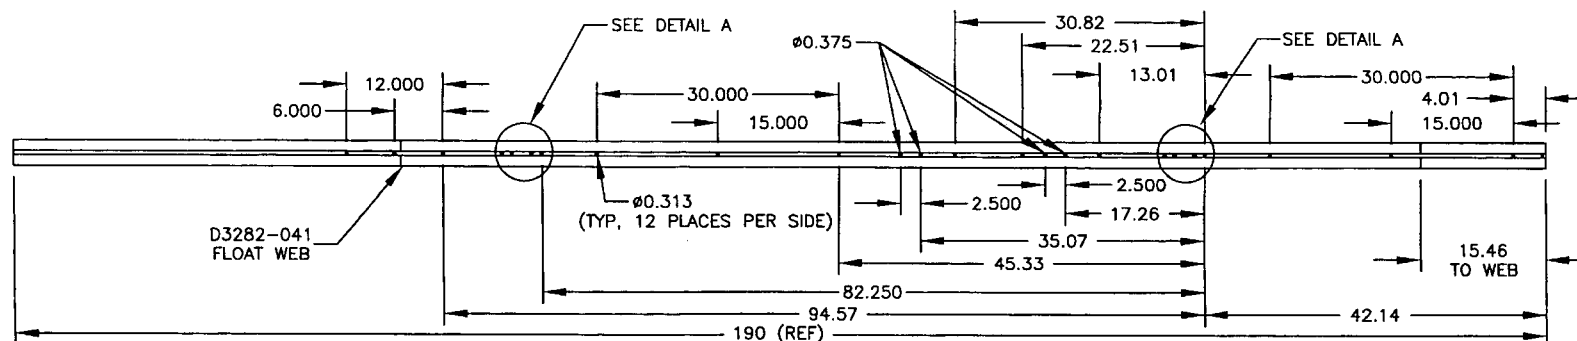

D3274-041 DRILLING/ASSEMBLY DETAIL

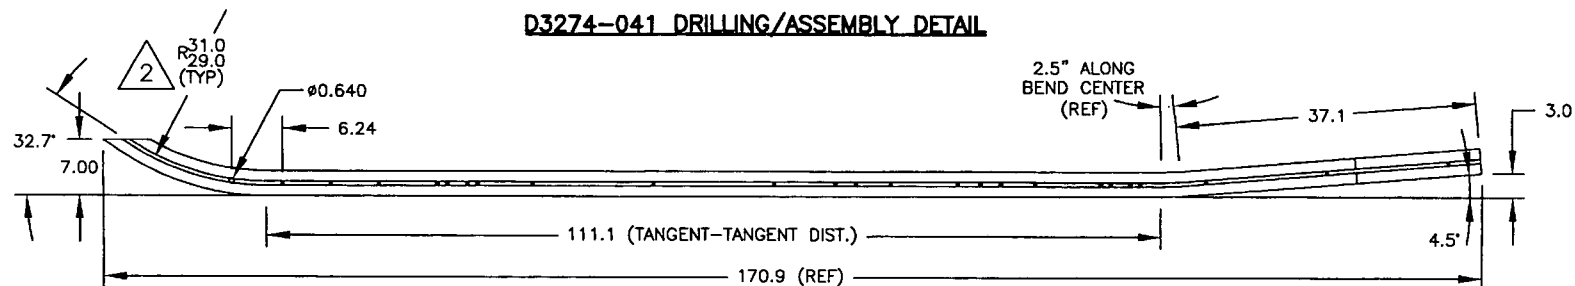

D3274-041 BEND/DRILLING DETAIL

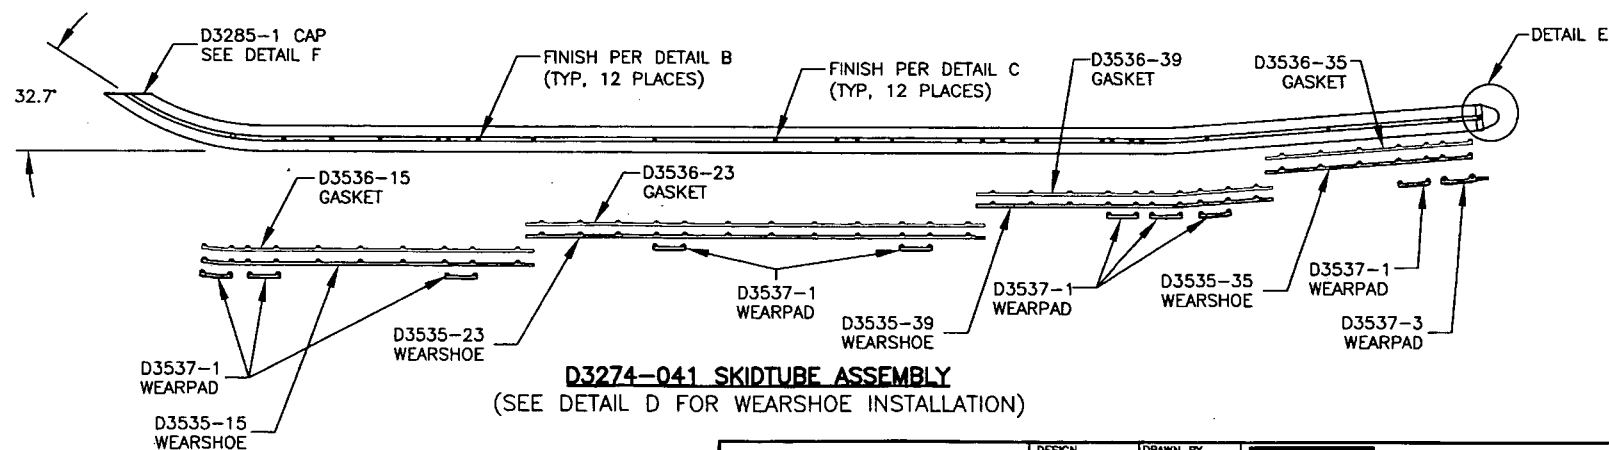

D3274-041 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO 33625A


RELEASED

07.02.12


COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.


DESIGN	CP	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, MA
CHECKED	#	APPROVED	#	DRAWING NO. D3274
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. D SHEET 2 OF 4 SCALE 1:15

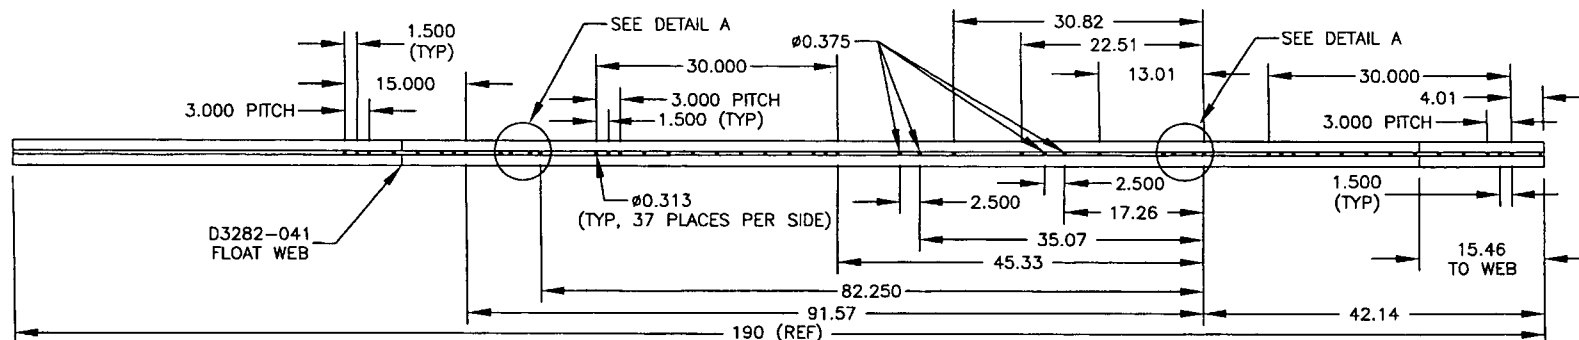

D3274-043 DRILLING/ASSEMBLY DETAIL

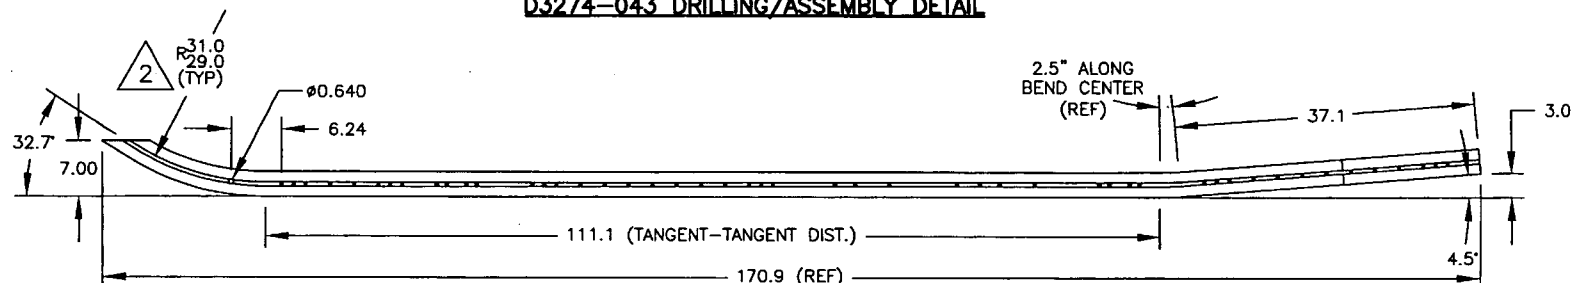

D3274-043 BEND/DRILLING DETAIL

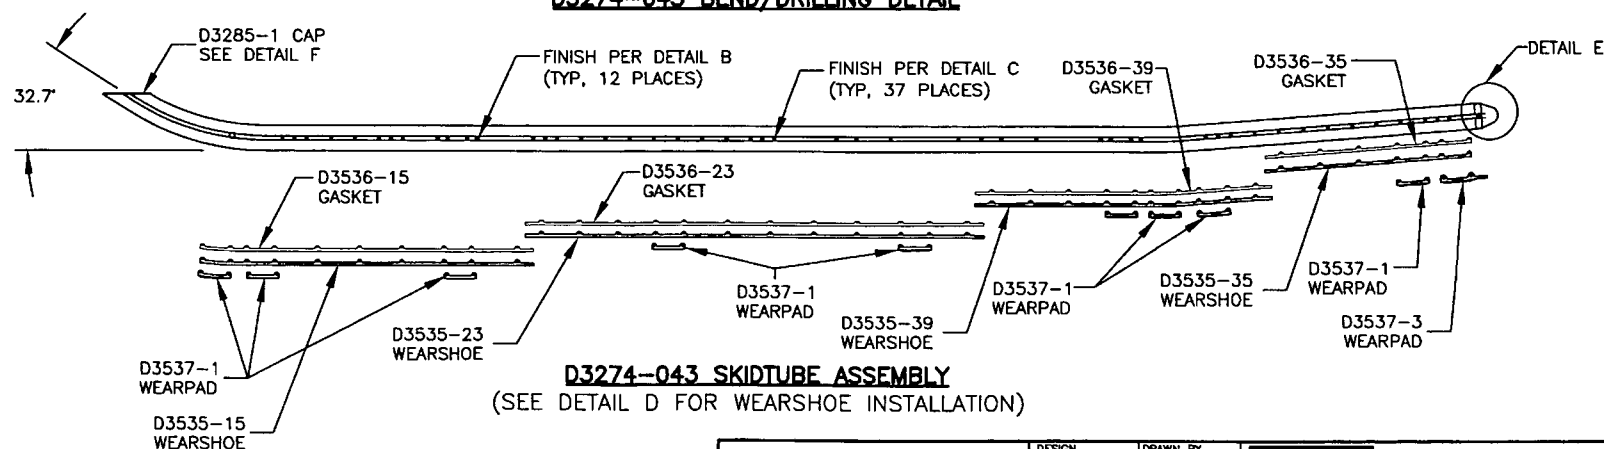

D3274-043 SKIDTUBE ASSEMBLY
(SEE DETAIL D FOR WEARSHOE INSTALLATION)

NO. 33625 A
WORK ORDER
SUBJECT TO AMENDMENT
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY

RELEASED


07-02-12

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

DESIGN	CP	DRAWN BY	PH	DART DART AEROSPACE USA, INC. PORT HADLOCK, WA
CHECKED	HA	APPROVED	HA	DRAWING NO. D3274
DATE	06.12.19	TITLE	SKIDTUBE ASSEMBLY	REV. D SHEET 3 OF 4 SCALE 1:15

DETAIL A: DRILL DETAIL

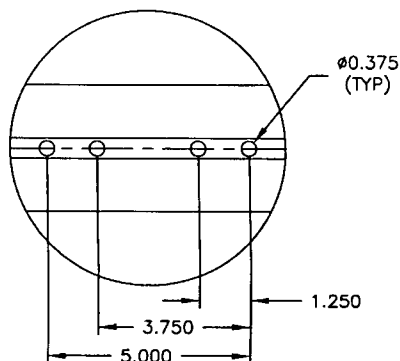


DETAIL B FOR 0.375 HOLES ONLY

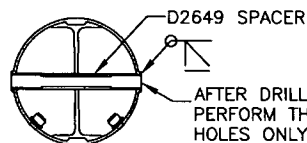


- AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR 0.375
HOLES ONLY:
1. CHAMFER HOLE 0.030x45°
 2. INSERT D2649 SPACER
 3. WELD INTO PLACE AND GRIND FLUSH
 4. C'BORE TO 0.313x0.75 DEEP

DETAIL C FOR 0.313 HOLES ONLY

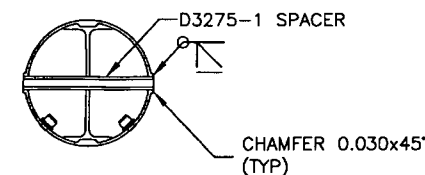


DETAIL D

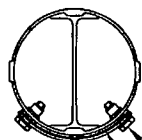

- ALS7-1032-130 INSERT (1)
AN3C4A BOLT (1)
AN960C10L WASHER (1)
(78 PLACES)
GASKET/WEARSHOE/WEARPAD (REF)

DETAIL F: END FINISHING DETAIL

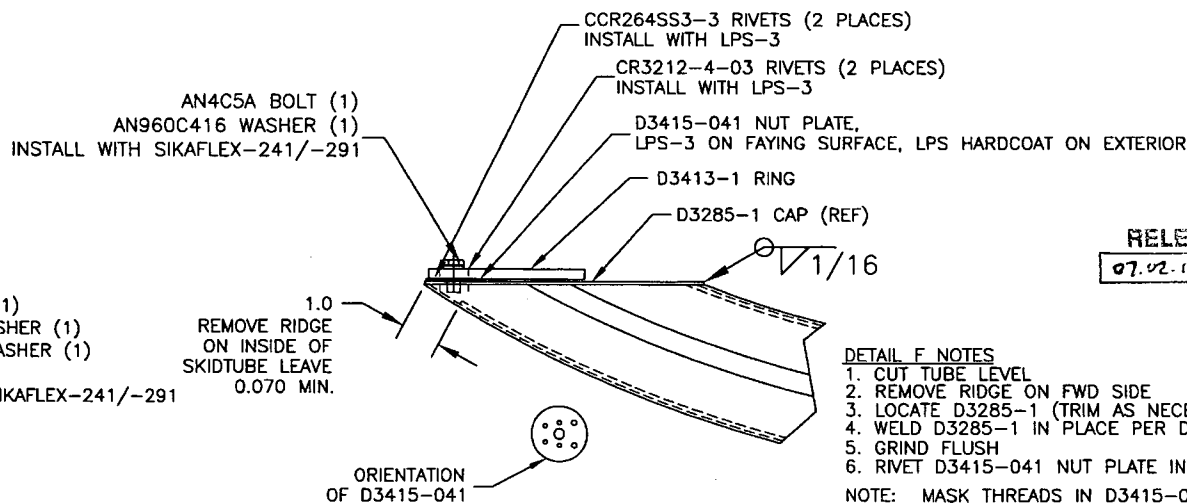

DETAIL F NOTES

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D3285-1 (TRIM AS NECESSARY)
4. WELD D3285-1 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D3415-041 NUT PLATE IN PLACE


NOTE: MASK THREADS IN D3415-041
PRIOR TO FINISH

RELEASED

07.02.12

DETAIL E

- AN3C4A BOLT (1)
AN960C10L WASHER (1)
NAS1515H3L WASHER (1)
(2 PLACES)
INSTALL WITH SIKAFLEX-241/-291

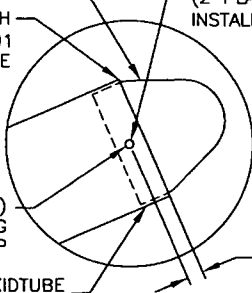

0.208 (2 PLACES)
DRILL PRIOR TO INSTALLING
D2646 CAP

BORE OUT END OF SKIDTUBE
TO 0.75 DEPTH AND 0.070 WALL

NO. 33625A
WORK ORDER
WITHOUT NOTICES
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY
D2646 CAP
SEAL WITH
SIKAFLEX-241/291
ADHESIVE

COPYRIGHT © 2004 BY DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL
AND IS SUPPLIED ON THE EXPRESS CONDITION
THAT IT IS NOT TO BE USED FOR ANY PURPOSE
OR COPIED OR COMMUNICATED TO ANY OTHER
PERSON WITHOUT WRITTEN PERMISSION FROM
DART AEROSPACE USA, INC.

DESIGN

CP

DRAWN BY

PH

CHECKED

#

APPROVED

#

DATE

06.12.19

DART DART AEROSPACE USA, INC.
PORT HADLOCK, MA

DRAWING NO.

D3274

REV. D

SHEET 4 OF 4

TITLE

SKIDTUBE ASSEMBLY

SCALE

1:3

NO. 122

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name Barclay Elliott
Joint Welding Procedure Tig
Part number and Job number A206642541 / 333624 A

TEST WELDS REQUIRED

BASE METAL Alum WELDING PROCESS Tig
Penetration Complete ☐ Partial ☒ Single Weld ☒ Double Weld ☐
Current AC ☒ DC ☐ Backing YES ☐ NO ☒

	Position	Vertical	Down <input type="checkbox"/>	Up <input type="checkbox"/>
Sheet Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	3G <input type="checkbox"/>	4G <input type="checkbox"/>
Tube Groove	1G <input type="checkbox"/>	2G <input type="checkbox"/>	5G <input type="checkbox"/>	6G <input type="checkbox"/>
Sheet Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	3F <input type="checkbox"/>	4F <input type="checkbox"/>
Tube Fillet	1F <input type="checkbox"/>	2F <input type="checkbox"/>	4F <input type="checkbox"/>	5F <input type="checkbox"/>

Crossbolt Spacer Welded into Skidtube

TEST RESULTS

Visual Pass ☒ Fail ☐
Penetration Pass ☒ Fail ☐
Crossbolt Spacer Pass ☒ Fail ☐

The above named individual is qualified in accordance with AWS D17.1.2001 to weld

Date of Test Coupon 9/10/08 Qualifier David David